

Manhole Inspection Summary

Manhole # S06EE_024MH

Printed On: 6/24/2010

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **2) Good**

Record Plat: **06EE** Node: **024** Status: **Found**

Insp Date: **8/24/09 11:05 AM**

Incomplete Comments

Crew: **RL ET**
Inspector: **Lamont**
Firm: **URS**

Location Address: **5006 ASHMANS HOPE**

Cross Street: **BEECHWOOD AVE**

Manhole Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **32** (in.) Length: (in.) Dist A/B Grade: **2** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **3** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Precast Concrete**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Precast Concrete**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☐ Exists Material:

☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Concrete**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Steps

Count: **6** Missing: **0** ☐ Corroded


Surcharge

☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present


Location View



Top View

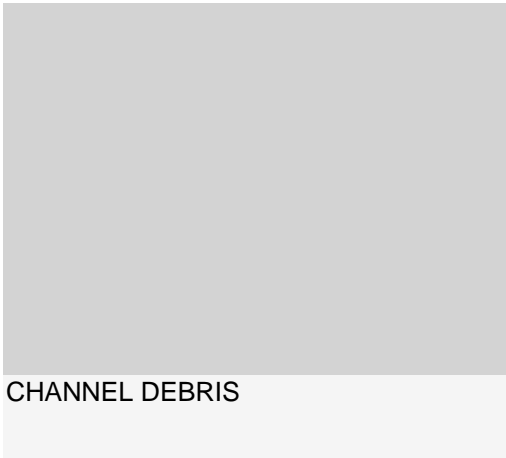

Top View

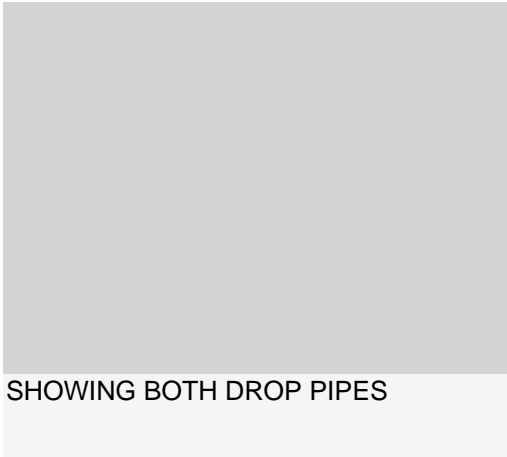

GRADE ADJUSTMENT



Manhole Inspection Summary


Manhole # S06EE_024MH

Printed On: 6/24/2010

Page 3 of 4

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



BOTTOM OF MH IS 4" BELOW PIPE.

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **PVC** ☐ Pipe Lined

Invert Depth: **8.34** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**


Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow

Drop In @ 6 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **PVC** ☐ Pipe Lined

Invert Depth: **4.52** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **Outside** Rod and Bar
Angled: **Yes** Reading: **7.28** (ft.)
Inv Depth: **8.28** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**


☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

7 O'Clock Inflow

Pipe In @ 7 O'Clock

Drop In @ 7 O'Clock

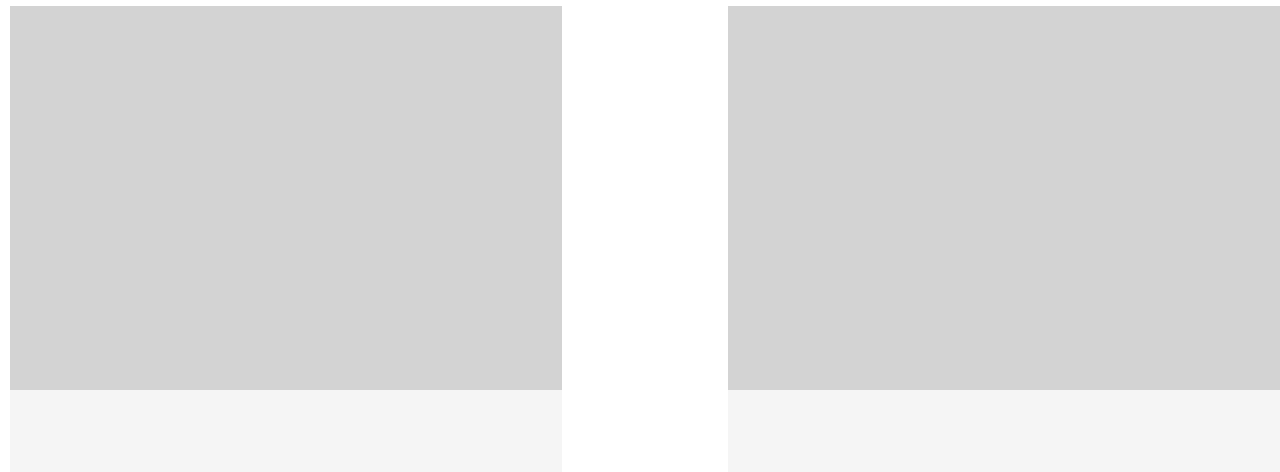

Pipe Height: 8.4 (in.) Rod and Bar (Angled)

Pipe Material: PVC ☐ Pipe Lined

Invert Depth: 6.54 (ft.) Flow Characteristics: None

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: None Pipe Seal Cond: Sound

Drop: Outside Rod and Bar

Angled: Yes Reading: 7.18 (ft.)

Inv Depth: 8.18 (ft.)

Drop Condition: Open

Connects To: Manhole

☐ Possible Illicit Connection